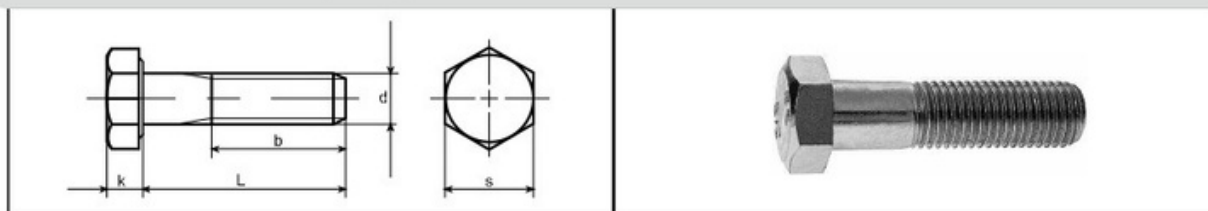


ISO 4014 EN
24014

d	M4	M5	M6	M7	M8	M10	M12	M14		
P	0,7	0,8	1	1	1,25	1,5	1,75	2		
b ⁰⁾	(1)	14	16	18	20	22	26	34		
	(2)	-	22	24	26	28	32	40		
	(3)	-	-	-	-	-	45	49	53	
k	2,8	3,5	4	4,8	5,3	6,4	7,5	8,8		
s	7	8	10	11	13	17/16*	19/18*	22/21*		
L	(25-40)	(25-50)	(30-60)	(30-70)	(35-80)	(40-100)	(45-120)	(50-140)		
d	M16	M18	M20	M22	M24	M27	M30	M33		
P	2	2,5	2,5	2,5	3	3	3,5	3,5		
b ⁰⁾	(1)	38	42	46	50	54	60	66	72	
	(2)	44	48	52	56	60	66	72	78	
	(3)	57	61	65	69	73	79	85	91	
k	10	11,5	12,5	14	15	17	18,7	21		
s	24	27	30	32/34*	36	41	46	50		
L	(55-160)	(65-180)	(65-200)	(70-220)	(80-240)	(90-260)	(90-300)	(100-300)		
d	M36	M39	M42	M45	M48	M52	M56	M60	M64	
P	4	4	4,5	4,5	5	5	5,5	5,5	6	
b ⁰⁾	(1)	78	84	90	96	102	-	-	-	
	(2)	84	90	96	102	108	116	124	132	140
	(3)	97	103	109	115	121	129	137	145	153
k	22,5	25	26	28	30	33	35	38	40	
s	55	60	65	70	75	80	85	90	95	
L	(110-300)	(12-300)	(130-300)	(130-300)	(140-340)	(150-340)	(160-360)	(170-360)	(180-360)	
4.6	4.8	5.6	5.8	6.8 ●	8.8 ●	10.9 ●	12.9 ●	A2 ●	A4 ●	

b¹ (1) L ≤ 125 mm. (2) 125 mm < L ≤ 200 mm. (3) L > 200 mm. * Tamaño según norma ISO.